

The OFFICE of the MARION COUNTY SURVEYOR

# SECTION CORNER RECORD

MARION COUNTY, INDIANA


Sec. 33 Twp. 17 Range 5

DATE: 3-14-94

CREW: P.C.- Kiste

INST. -                      ROD. -                     


TYPE of MARKER: Harrison COND. of MARKER: History

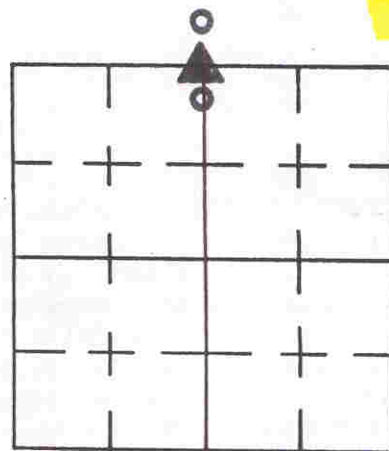

IN. S.P.C. E. ZONE, NAD 83.  
NAME: 17053302  
N: 514674.6088(m)  
E: 74345.1007(m)

N 1/4 33-17-5  
N 33-17-5

PAGE      OF     

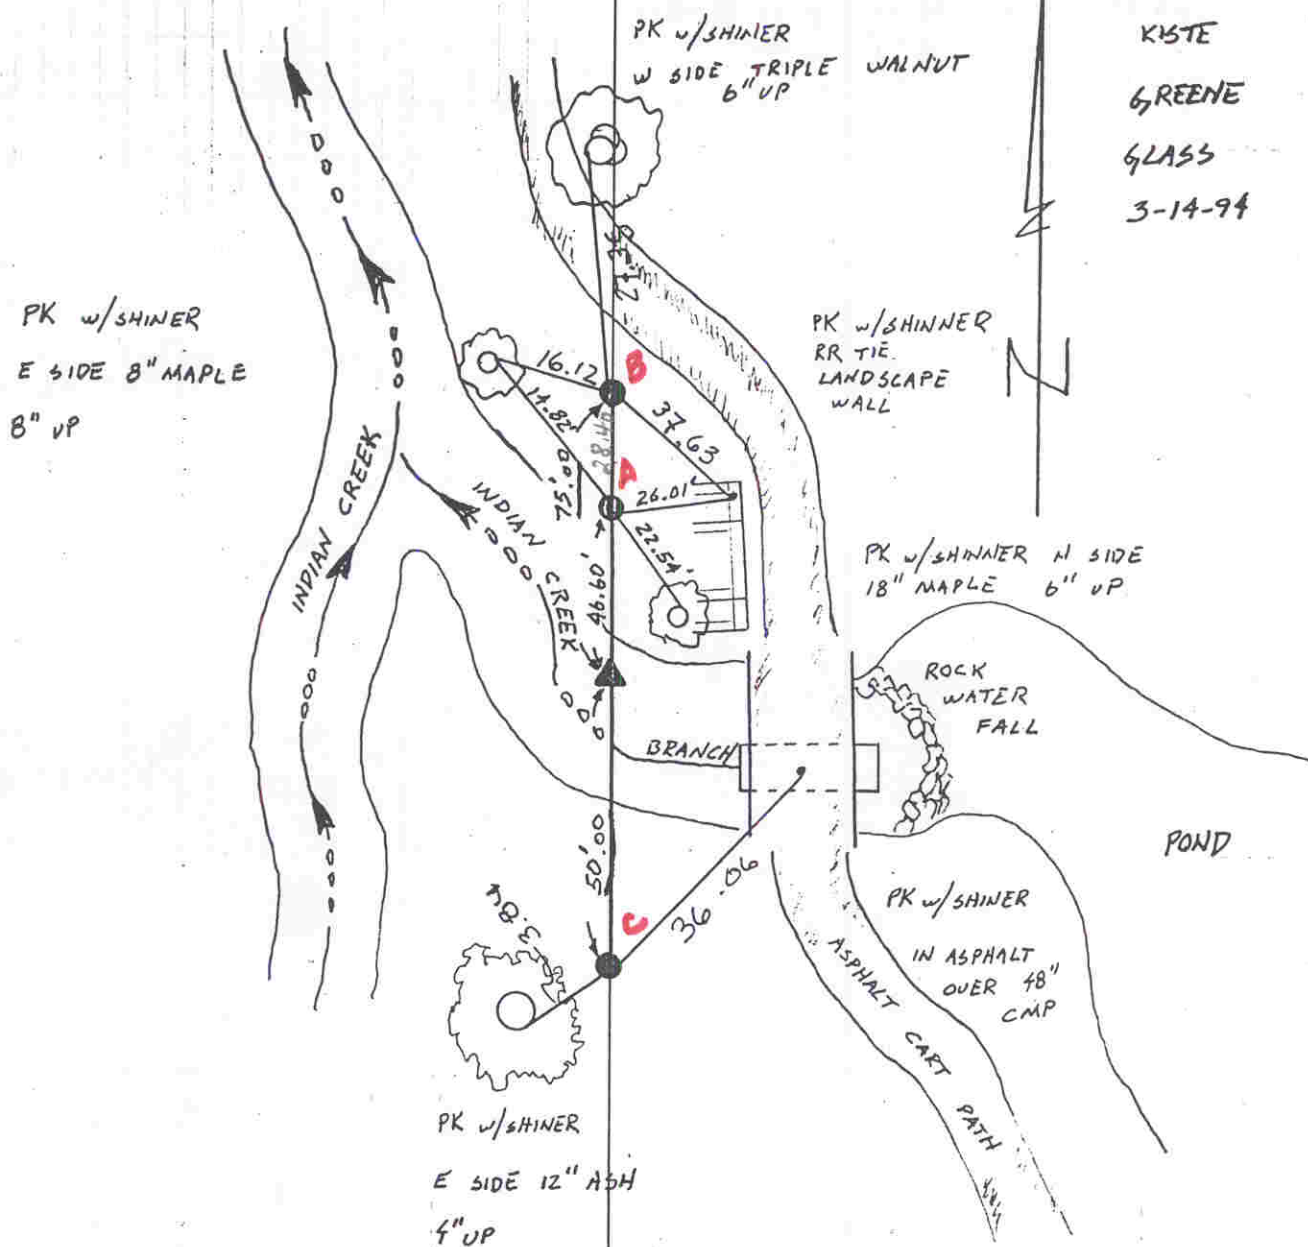

NOTE: RESET WITNESS HARRISONS  
DUE TO CREEK BANK EROSION/  
FD: IRON PIN IN 2" PIPE SET  
BY WILCOXEN IN 8-20-93  
SET NEW WITNESSES ON LINE  
WITH OLD ONES, SET NEW SOUTH  
WITNESS 50' FROM CORNER 1/4 NORTH  
WITNESS 75' FROM CORNER.

HC753302

N 33-17-5

CORNER HISTORY: Original survey by William B. Laughlin, Deputy Surveyor in 1821. Post set at corner. Witnesses were: 10 inch Sugar Maple bearing North  $74^{\circ}$  East a distance of 10 links and 14 inch Ash bearing South  $3^{\circ}$  West a distance of 30 links. A Legal Survey in March 1854 by Alexander Wilson, Deputy Surveyor (Lawrence Legal Book, Page 14) labels the corner "I" and calls it a Rock. Distances are given to corners to the East, North and West. A Legal Survey in January 1931 by the County Surveyor labels the corner "E" and calls for a stone found at the corner. The corner was re-established in June 1979 by the Marion County Surveyor's Office using the 1931 Legal Survey. The distance between the Northeast corner and the Northeast corner of the West half of the Northeast quarter of Section 33 (found per said Legal Survey) was measured and compared with the Legal Survey distance. The location of the North quarter corner was then computed using proportionate measurement based on the distances from the Legal Survey along the North line of the Northeast quarter compared with the measured distance described above. The corner was set (5/8 inch rebar in the creek bed) and ties were taken on June 1, 1979. Those ties were redrawn on March 12, 1982. This corner was excavated on August 12, 1982 by Green (Marion County Surveyor's Office). The 5/8 inch rebar referred to in the June 1979 ties could not be located and no other marker was found at the corner. The ties; however, were good. Rather than set a new monument in the creek bed, we set three Harrison #305 cast iron monuments in concrete as witnesses in addition to the other ties.